




LEGEND



Filled-up soil with debris

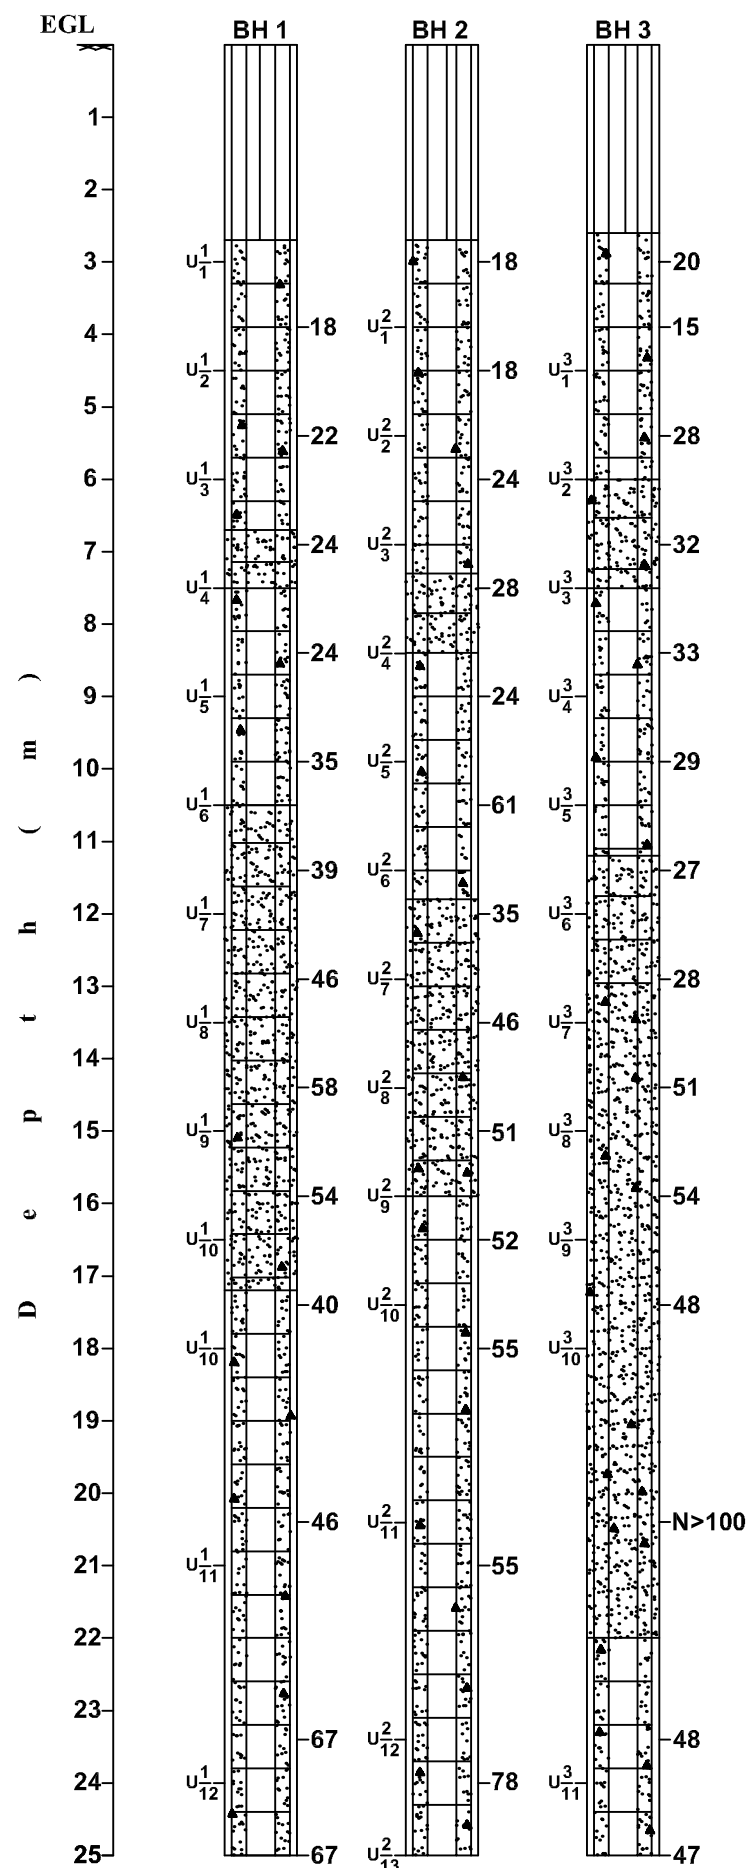

Yellowish brown clayey sandy silt with  
(2-13)% (20-46)% (37-65)%  
occasional gravel  
(0-27)%



Yellowish brown silty sand with  
(22-57)% (27-76)%  
occasional clay and gravel  
(0-10)% (0-48)%

48 Observed 'N' Values

u<sub>2</sub><sup>1</sup> 2<sup>nd</sup> undisturbed soil sample of BH 1

Ground Water table has not been encountered.

COMPILED SOIL PROFILE



|                                    |                                                           |                   |
|------------------------------------|-----------------------------------------------------------|-------------------|
| NAGADI CONSULTANTS PRIVATE LIMITED |                                                           | Job No: G(D) 4566 |
| GEOTECHNICAL CONSULTANTS           |                                                           |                   |
| Delhi                              | : 011 (T) 26891980 (F) 26897403 delhi@nagadi.co.in        | Sheet No: 2       |
| Bangalore                          | : 080 (T) 23156076 (F) 23303007 bangalore@nagadi.co.in    |                   |
| Chennai                            | : 044 (T) 24487870 (F) 24488957 chennai@nagadi.co.in      |                   |
| Secunderabad                       | : 040 (T) 27754446 (F) 27751194 secunderabad@nagadi.co.in |                   |